

SAFETY DATA SHEET

SECTION 1) CHEMICAL PRODUCT AND MANUFACTURER'S IDENTIFICATION

Product ID: 496405
Product Name: Rubberized Undercoating
Revision Date: Feb 12, 2026 **Date Printed:** Feb 12, 2026
Version: 3.0 **Supersedes Date:** May 25, 2021
Manufacturer's Name: Zenex International
Address: 1 Zenex Circle Cleveland, OH, US, 44146
Emergency Phone: 1-800-535-5053
Information Phone Number: (440)-232-4155
Fax:
Product/Recommended Uses: Undercoating

SECTION 2) HAZARDS IDENTIFICATION

Classification

Aerosols - Category 1
Gases Under Pressure - Liquefied Gas
Aspiration Hazard - Category 1
Eye Irritation - Category 2
Skin Irritation - Category 2
Specific Target Organ Toxicity - Repeated Exposure - Category 3

Pictograms



Signal Word

Danger

Hazardous Statements - Physical

H222 - Extremely flammable aerosol.
H280 - Contains gas under pressure; may explode if heated.

Hazardous Statements - Health

H304 - May be fatal if swallowed and enters airways.
H319 - Causes serious eye irritation.
H315 - Causes skin irritation.
H336 - May cause drowsiness or dizziness.

Precautionary Statements - General

P101 - If medical advice is needed, have product container or label at hand.

P102 - Keep out of reach of children.

P103 - Read label before use.

Precautionary Statements - Prevention

P210 - Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.

P211 - Do not spray on an open flame or other ignition source.

P251 - Do not pierce or burn, even after use.

P280 - Wear protective gloves, protective clothing, eye protection and face protection.

P264 - Wash hands thoroughly after handling.

P260 - Do not breathe mist, vapors or spray.

P271 - Use only outdoors or in a well-ventilated area.

Precautionary Statements - Response

P314 - Get medical attention if you feel unwell.

P308 + P313 - IF exposed or concerned: Get medical attention.

P301 + P310 - IF SWALLOWED: Immediately call a POISON CENTER or doctor.

P331 - Do NOT induce vomiting.

P305 + P351 + P338 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

P337 + P313 - If eye irritation persists: Get medical attention.

P302 + P352 - IF ON SKIN: Wash with plenty of soap and water.

P362 + P364 - Take off contaminated clothing and wash it before reuse.

P332 + P313 - If skin irritation occurs: Get medical attention.

Precautionary Statements - Storage

P410 + P412 - Protect from sunlight. Do not expose to temperatures exceeding 50°C / 122°F.

Precautionary Statements - Disposal

P501 - Dispose of contents and container in accordance with local, regional, national and international regulations.

SECTION 3) COMPOSITION, INFORMATION ON INGREDIENTS

CAS	Chemical Name	% By Weight
0068476-86-8	Petroleum gases, liquefied, sweetened	15% - 25%
0426260-76-6	Heptane, branched, cyclic, and linear	10% - 20%
0000079-20-9	Methyl Acetate	15% - 25%
0000067-64-1	Acetone	5% - 10%
0014807-96-6	Talc	5% - 10%
0066070-58-4	Polymer: styrene-butadiene hydrogenated	1% - 5%
Various	Pigment	1% - 5%

Specific chemical identity and/or exact percentage (concentration) of the composition has been withheld to protect confidentiality.

SECTION 4) FIRST-AID MEASURES

Inhalation

IF INHALED: Remove person to fresh air and keep comfortable for breathing. If breathing is labored, administer oxygen. If symptoms develop, obtain medical attention. Call a POISON CENTER/doctor if you feel unwell. Eliminate all ignition sources if safe to do so.

Eye Contact

IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If eye irritation persists: Get medical advice/attention.

Skin Contact

Take off contaminated clothing, shoes and leather goods (e.g. watchbands, belts). Wash with plenty of lukewarm, gently flowing water for a duration of 15-20 minutes. If skin irritation occurs: Get medical advice/attention. Wash contaminated clothing before reuse. IF exposed or concerned: Get medical advice/attention.

Ingestion

Immediately call a POISON CENTER/doctor. Do NOT induce vomiting. If vomiting occurs naturally, lie on your side, in the recovery position.

Most Important Symptoms/Effects, Acute and Delayed

May cause drowsiness and dizziness. Aspiration of droplets may cause pulmonary oedema.

Indication of Immediate Medical Attention and Special Treatment Needed

IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician.

SECTION 5) FIRE-FIGHTING MEASURES

Suitable Extinguishing Media

Dry chemical, foam, carbon dioxide. Carbon dioxide can displace oxygen. Use caution when applying carbon dioxide in confined spaces. Simultaneous use of foam and water on the same surface is to be avoided as water destroys the foam. Sand or earth may be used for small fires only. Do not direct a solid stream of water or foam into hot, burning pools. This may result in frothing and increased fire intensity.

Unsuitable Extinguishing Media

Do not use water jet.

Specific Hazards in Case of Fire

Contents under pressure. Keep away from ignition sources and open flames. Exposure of containers to extreme heat and flames can cause them to rupture often with violent force.

Product is highly flammable and forms explosive mixtures with air, oxygen, and all oxidizing agents. Vapors are heavier than air and may travel along surfaces to remote ignition sources and flash back. During a fire, irritating and highly toxic gases may be generated during combustion or decomposition. High temperatures can cause sealed containers to rupture due to a build up of internal pressures. Cool with water. Empty Containers retain product residue which may exhibit hazards of material; therefore do not pressurize, cut, glaze, weld or use for any other purposes. Container could potentially burst or be punctured upon mechanical impact, releasing flammable vapors.

Fire-Fighting Procedures

Isolate immediate hazard area and keep unauthorized personnel out. Stop spill/release if it can be done safely. Move undamaged containers from immediate hazard area if it can be done safely. Water spray may be useful in minimizing or dispersing vapors and to protect personnel. Water may be ineffective but can be used to cool containers exposed to heat or flame. Caution should be exercised when using water or foam as frothing may occur, especially if sprayed into containers of hot, burning liquid.

Special Protective Actions

Wear protective pressure self-contained breathing apparatus (SCBA) and full turnout gear.

SECTION 6) ACCIDENTAL RELEASE MEASURES

Emergency Procedure

ELIMINATE all ignition sources (no smoking, flares, sparks or flames in immediate area).

Do not touch or walk through spilled material.

Isolate hazard area and keep unnecessary people away. Remove all possible sources of ignition in the surrounding area. Notify authorities if any exposure to the general public or the environment occurs or is likely to occur.

If spilled material is cleaned up using a regulated solvent, the resulting waste mixture may be regulated.

Recommended Equipment

Wear liquid tight chemical protective clothing in combination with positive pressure self-contained breathing apparatus (SCBA).

Personal Precautions

Avoid breathing vapor. Avoid contact with skin, eyes or clothing. Do not touch damaged containers or spilled materials unless wearing appropriate protective clothing.

ELIMINATE all ignition sources (no smoking, flares, sparks or flames in immediate area).

Environmental Precautions

Stop spill/release if it can be done safely. Prevent spilled material from entering sewers, storm drains, other unauthorized drainage systems and natural waterways by using sand, earth, or other appropriate barriers.

Methods and Materials for Containment and Cleaning up

Absorb liquids in vermiculite, dry sand, earth, or similar inert material and deposit in sealed containers for disposal.

SECTION 7) HANDLING AND STORAGE

General

Wash hands after use. Do not get in eyes, on skin or on clothing.

Do not breathe vapors or mists.

Use good personal hygiene practices.

Eating, drinking and smoking in work areas is prohibited.

Remove contaminated clothing and protective equipment before entering eating areas.

Eyewash stations and showers should be available in areas where this material is used and stored.

Keep away from heat/sparks/open flames/hot surfaces. – No smoking.

Ventilation Requirements

Use only with adequate ventilation to control air contaminants to their exposure limits. The use of local ventilation is recommended to control emissions near the source.

Storage Room Requirements

Do not cut, drill, grind, weld, or perform similar operations on or near containers. Store locked up. Keep in a cool, well ventilated place. Protect from sunlight. Store at temperatures not exceeding 50 °C / 122 °F. Keep container tightly closed.

SECTION 8) EXPOSURE CONTROLS/PERSONAL PROTECTION

Eye Protection

Wear eye protection with side shields or goggles. Wear indirect-vent, impact and splash resistant goggles when working with liquids. If additional protection is needed for entire face, use in combination with a face shield.

Skin Protection

Use of gloves approved to relevant standards made from the following materials may provide suitable chemical protection: PVC, neoprene or nitrile rubber gloves. Suitability and durability of a glove is dependent on usage, e.g. frequency and duration of contact, chemical resistance of glove material, glove thickness, dexterity. Always seek advice from glove suppliers. Contaminated gloves should be replaced. Use of an apron and over-boots of chemically impervious materials such as neoprene or nitrile rubber is recommended to avoid skin sensitization. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace. Launder soiled clothes or properly disposed of contaminated material, which cannot be decontaminated.

Respiratory Protection

If engineering controls do not maintain airborne concentrations to a level which is adequate to protect worker, a respiratory protection program that meets or is equivalent to OSHA 29 CFR 1910.134 and ANSI Z88.2 should be followed. Check with respiratory protective equipment suppliers.

Appropriate Engineering Controls

Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value.

Chemical Name	OSHA TWA (mg/m3)	OSHA TWA (ppm)	OSHA STEL (mg/m3)	OSHA Carcinogen	OSHA Skin designation	OSHA Tables (Z1, Z2, Z3)	ACGIH TWA (mg/m3)	ACGIH TWA (ppm)
Acetone	2400	1000				1		250
Methyl Acetate	610	200				1		100
Heptane	2000	500				1		400
Petroleum gases, liquefied, sweetened	2000	500				1		

Chemical Name	NIOSH STEL (ppm)	ACGIH STEL (mg/m3)	ACGIH STEL (ppm)	ACGIH Carcinogen	ACGIH TLV Basis	ACGIH Notations	NIOSH TWA (mg/m3)	NIOSH TWA (ppm)
Acetone			500	A4	URT & eye irr; CNS impair	A4; BEI	590	250
Methyl Acetate	250		250		Headache; dizziness; nausea; eye dam(degenerati on of ganglion cells in the retina)		610	200
Heptane	400	2050	500		URT; CNS impair		350	85
Petroleum gases, liquefied, sweetened								

Chemical Name	NIOSH STEL (mg/m3)	OSHA STEL (ppm)	NIOSH Carcinogen
Acetone			
Methyl Acetate	760		
Heptane			
Petroleum gases, liquefied, sweetened			

(C) - Ceiling limit, (L) - Exposure by all routes should be carefully controlled to levels as low as possible, A1 - Confirmed Human Carcinogen, A4 -Not Classifiable as a Human Carcinogen, BEI - Substances for which there is a Biological Exposure Index or Indices, CNS - Central nervous system, impair - Impairment, irr - Irritation, repro - reproductive, URT - Upper respiratory tract

SECTION 9) PHYSICAL AND CHEMICAL PROPERTIES

Physical and Chemical Properties

Density	8.33 lb/gal
% VOC	<40%
Appearance	Colorless
Odor Threshold	N.A.
Odor Description	N.A.
pH	N.A.
Water Solubility	N.A.
Flammability	Highly Flammable

Vapor Pressure	N.A.
Flash Point Viscosity	N.A.
Lower Explosion Level	N.A.
Upper Explosion Level	N.A.
Vapor Density	N.A.
Melting Point	N.A.
Freezing Point	N.A.
Low Boiling Point	N.A.
High Boiling Point	N.A.
Decomposition Pt	N.A.
Auto Ignition Temp	N.A.
Evaporation Rate	Slower than ether

SECTION 10) STABILITY AND REACTIVITY

Stability

The product is stable under normal storage conditions.

Conditions to Avoid

Avoid heat, sparks, flame, high temperature and contact with incompatible materials.

Dropping containers may cause bursting.

Incompatible Materials

Avoid strong oxidizers, reducers, acids, and alkalis. . Acetone may form explosive mixtures in contact with chromic anhydride, chromyl alcohol, hexachloromelamine, hydrogen peroxide,permonosulfuric acid, potassium tertbutoxide and thioglycol.

Hazardous Reactions/Polymerization

None known.

Hazardous Decomposition Products

Forms carbon oxides under fire conditions.

SECTION 11) TOXICOLOGICAL INFORMATION

Skin Corrosion/Irritation

Causes skin irritation.

Likely Route of Exposure

Inhalation, Skin Contact, Eye Contact

Serious Eye Damage/Irritation

Causes serious eye irritation.

Carcinogenicity

It is unlikely to present a carcinogenic hazard to man.

Germ Cell Mutagenicity

Negative

Reproductive Toxicity

Negative

Respiratory/Skin Sensitization

No data available.

Specific Target Organ Toxicity - Single Exposure

No data available.

Specific Target Organ Toxicity - Repeated Exposure

May cause damage to organs through prolonged or repeated exposure.

Aspiration Hazard

May be fatal if swallowed and enters airways.

Acute Toxicity

(Calculated/estimated)

Oral: LD50 >5 g/kg-bw

Dermal: LD50 >2 g/kg-bw

Inhalation: LC50 = 65 - 103 mg/L (Vapor), 4-hr. rat

May cause drowsiness or dizziness.

May be fatal if swallowed and enters airways.

Chronic Exposure

Oral NOAEL = 900 mg/kg/day (rat) (90-days)

Inhalation NOAEL > 19,000 ppm (rat)

Potential Health Effects - Miscellaneous

No data available.

SECTION 12) ECOLOGICAL INFORMATION

Toxicity

No data available.

Persistence and Degradability

Readily biodegradable

Bio-Accumulative Potential

No data available.

Mobility in Soil

No data available.

Other Adverse Effects

No data available.

SECTION 13) DISPOSAL CONSIDERATIONS

Waste Disposal

Under RCRA, it is the responsibility of the user of the product, to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state, and local laws.

Empty containers retain product residue which may exhibit hazards of material, therefore do not pressurize, cut, glaze, weld or use for any other purposes. Return drums to reclamation centers for proper cleaning and reuse.

SECTION 14) TRANSPORT INFORMATION

	IATA Information	IMDG Information	U.S. DOT Information
UN number:	UN1950	UN1950	UN1950
Proper shipping name:	Aerosols, flammable	Aerosols	Aerosols
Hazard class:	2.1	2.1	2.1
Packaging group:	NA	NA	NA
Hazardous substance (RQ):			No Data Available
Marine Pollutant:		No Data Available	No Data Available
Note / Special Provision:	(LTD QTY)	(LTD QTY)	(LTD QTY)
Toxic-Inhalation Hazard:			No Data Available

SECTION 15) REGULATORY INFORMATION

CAS	Chemical Name	% By Weight	Regulation List
0068476-86-8	Petroleum gases, liquefied, sweetened	15% - 25%	SARA312, TSCA, OSHA
0426260-76-6	Heptane, branched, cyclic, and linear	10% - 20%	SARA312, TSCA, ACGIH, OSHA
0000079-20-9	Methyl Acetate	15% - 25%	SARA312, TSCA, ACGIH, OSHA
0000067-64-1	Acetone	5% - 10%	CERCLA, SARA312, TSCA, RCRA, ACGIH, OSHA
0014807-96-6	Talc	5% - 10%	SARA312, TSCA, ACGIH, OSHA
0066070-58-4	Polymer: styrene-butadiene hydrogenated	1% - 5%	TSCA
Various	Pigment	1% - 5%	

SECTION 16) OTHER INFORMATION


Glossary

ACGIH- American Conference of Governmental Industrial Hygienists; ANSI- American National Standards Institute; Canadian TDG- Canadian Transportation of Dangerous Goods; CAS- Chemical Abstract Service; Chemtrec- Chemical Transportation Emergency Center (US); CHIP- Chemical Hazard Information and Packaging; DSL- Domestic Substances List; EC- Equivalent Concentration; EH40 (UK)- HSE Guidance Note EH40 Occupational Exposure Limits; EPCRA- Emergency Planning and Community Right-To-Know Act; ESL- Effects screening levels; HMIS- Hazardous Material Information Service; LC- Lethal Concentration; LD- Lethal Dose; NFPA- National Fire Protection Association; OEL- Occupational Exposure Limits; OSHA- Occupational Safety and Health Administration, US Department of Labor; PEL- Permissible Exposure Limit; SARA (Title III)- Superfund Amendments and Reauthorization Act; SARA 313- Superfund Amendments and Reauthorization Act, Section 313; SCBA- Self-Contained Breathing Apparatus; STEL- Short Term Exposure Limit; TCEQ- Texas Commission on Environmental Quality; TLV- Threshold Limit Value; TSCA- Toxic Substances Control Act Public Law 94-469; TWA- Time Weighted Value; US DOT- US Department of Transportation; WHMIS- Workplace Hazardous Materials Information System.

HMIS

Health	* 2
FLAMMABILITY	4
Physical Hazard	0
Personal Protection	B

NFPA

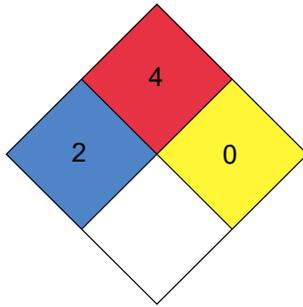

(*) - Chronic effects

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks

DISCLAIMER

To the best of our knowledge, the information contained herein is accurate. However, neither the above named supplier nor any of its subsidiaries assumes any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist. The above information pertains to this product as currently formulated, and is based on the information available at this time. Addition of reducers or other additives to this product may substantially alter the composition and hazards of the product. Since conditions of use are outside our control, we make no warranties, express or implied, and assume no liability in connection with any use of this information.